

Jeffrey J. Mulvihill Consulting  
800 Hallmark Drive  
Redding, California 96001-0151  
(530) 243-3187  
[jeffmsr@sbcglobal.net](mailto:jeffmsr@sbcglobal.net)

August 2, 2012

Punch List: Doors Frames & Hardware

Architect: Nichols Melburg & Rossetto

Contractor: Randy Hill Construction, Inc.

JOB: College of the Siskiyous Science Building NMR Project: 08-2420.00

Comments/Corrections:

1. Door 101BA: replace dented head trim on both panics.
2. Door Closers: adjust all closers for opening pressure, sweep, latch and back check.
3. Door 217B: lock does not line up with frame strike.
4. Door 121B, 207AA, 212B: install door stop.
5. Door 202A: do not use Door Closer as door stop; move closer install wall stop.
6. Door 212B vision lite kit has a broken weld at bottom corridor side corner.
7. Doors 215B & 216A: there are extra trim holes in door face that show.
8. Door Binding: most interior doors do not close correctly the hinge gasket appears to be causing the binding try installing gasket on jamb face as opposed to the frame stop.
9. Doors not fully latching strike plates excessively ground; item 8 may solve this issue.